

TECHNICAL BULLETIN



YAESU U.S.A.

FILE NO: TB-9254
RELEASE DATE: 10-DEC-1992

Model No. FT-990 Serial No. Range Lot 019

Problem or Symptom: _____

Expected Results of Modifications: Improved receiver IMD.

Component Changes:

LOCATION	FROM	TO	NEW PART NUMBER
RF UNIT			
D1020	1SS83RE	1SV157-T1	G2060014
D1024	1SS83RE	1SV157-T1	G2060014
D1026	1SS83RE	1SV157-T1	G2060014
D1028	1SS83RE	1SV157-T1	G2060014
D1031	1SS83RE	1SV157-T1	G2060014
D1032	1SS83RE	1SV157-T1	G2060014
D1033	1SS83RE	1SV157-T1	G2060014
D1036	1SS83RE	1SV157-T1	G2060014
D1037	1SS83RE	1SV157-T1	G2060014
D1039	1SS83RE	1SV157-T1	G2060014
D1041	1SS83RE	1SV157-T1	G2060014
D1043	1SS83RE	1SV157-T1	G2060014
D1045	1SS83RE	1SV157-T1	G2090014
D1022	1SS83RE	MI204	G2090457
D1063	1SS55	MI204	G2090457

DAVID 562 404 2700 x245 2/2/01